

Book # 4

 *The Standard*
AIRCRAFT LOG

ASA-SA-1

YEAR 20____ DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
------------------------	---------------------------	-------------------	-----------------------------	---



9519 Airport Drive, Hanger 19
 Visalia, CA 93277

Airframe

DATE: 04/04/23 MODEL: 58 ACTT: 3967.4 HOBBS: 1344.1
 REG: N624TE S/N: TH-1588

- 1 BLED BOTH R/H & L/H BRAKES.
- 2 REPLACED RIVETS ON L/H INTAKE AIR SCOOP ON TOP OF COWLING.



RAPHAEL LOPEZ - A&P 2709706

PERTINENT DETAILS ON FILE: W.O. 624040423

YEAR 20____ DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
------------------------	---------------------------	-------------------	-----------------------------	---



9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

DATE: 09/07/22

MODEL: 58

ACTT: 3903.2

HOBBS: 1279.9

REG: N624TE

S/N: TH-1588

1 REMOVE & REPLACE R/H TACHOMETER P/N: 102-380011-25 S/N: 215 OVERHAULED BY PACIFIC SOUTHWEST INSTRUMENTS UNDER WORK ORDER # 346504 DATED 09/06/22.


RAPHAEL LOPEZ - A&P 2709706

PERTINENT DETAILS ON FILE: W.O. 624090722

YEAR
20
DATE



AMS

AIRCRAFT MECHANICAL SERVICES, inc.

9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

DATE: 08/15/22

MODEL: 58

ACTT: 3898.6

HOBBS: 1275.3

REG: N624TE

S/N: TH-1588

ANNUAL INSPECTION COMPLETED THIS DATE. ALL APPLICABLE AD'S CHECKED AND C/W
OR N/A AS LISTED IN AD LOG. I CERTIFY THAT THIS AIRFRAME WAS INSPECTED IN ACCORDANCE
WITH ANNUAL INSPECTION AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION.
APPROVED FOR RETURN TO SERVICE.

STEPHEN STEWART - IA 2129169

PERTINENT DETAILS ON FILE: W.O. 624081522



9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

YEAR
20____
DATE

DATE: 08/15/22 MODEL: 58 ACTT: 3898.6 HOBBS: 1275.3
REG: N624TE S/N: TH-1588

- 1 CW AD 2004-25-16R1 BY LEAK CHECK OF FUEL REGULATOR SHUT OFF VALVE, NEXT DUE 08/2023.
 - 2 CW AD 2017-16-01 BY INSP & OP'S CHECK OF AMERIKING ELT, NEXT DUE 08/2023.
 - 3 REMOVE & REPLACE R/H O.B. WHEEL BEARING P/N: 13889 & RACE P/N: 13836.
 - 4 REMOVE & REPLACE L/H FUEL BOOST PUMP P/N: 4404-00-7 S/N: 0212.
 - 5 REMOVE & REPLACE FLAP ACTUATORS COVERS P/N: 062.
 - 6 INSTALLATION OF STEINBACH & ASSOCIATES, INC. CONVERSION KIT P/N: 95210010-003 S/N: 40969. OF THE FACTORY R-12 AIR CONDITIONING SYSTEM TO R-134A REFRIGERANT ON BEECH TYPE CERTIFICATE NUMBER 3A16 MODEL 58 IN ACCORDANCE WITH STEINBACH AND ASSOCIATES TOP DRAWING NUMBER 95210000, REV B, DATED 07/09/1998, OR LATER FAA APPROVED REVISION. ALSO INSTALLED IN ACCORDANCE WITH SUPPLEMENTAL TYPE CERTIFICATE NUMBER SA09503SC. WEIGHT AND BALANCE IS NOT AFFECTED.
 - 7 REMOVE & REPLACE REAR EVAP MOTOR BRACKET ASSY P/N: 106-555012-25.
 - 8 INSPECTED ELT IN ACCORDANCE WITH FAR 91.207(D). (**BATTERY DUE 02/2026**).
- **02 BOTTLE HYDRO NEXT DUE: MAY 2025.**

RAPHAEL LOPEZ - A&P 2709706

PERTINENT DETAILS ON FILE: W.O. 624081522

YEAR 20____ DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
------------------------	---------------------------	-------------------	-----------------------------	---



9519 Airport Drive, Hanger 19
 Visalia, CA 93277

Airframe


DATE: 05/26/22 MODEL: 58 ACTT: 3885.9 HOBBS: 1262.6
 REG: N624TE S/N: TH-1588

1 SERVICED A/C SYSTEM WITH 2.4 POUNDS OF R-12 FREON.

RAPHAEL LOPEZ - A&P 2709706

PERTINENT DETAILS ON FILE: W.O. 624052622

YEAR 20____ DATE	RECO TACH TIME

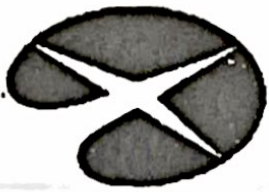

SIGNATURE
TECHNICAIR™

*Aircraft Maintenance
A BBA Aviation company*

BEECH B58 N624TE S/N TH-1588 28 MAR 2022

The following maintenance was performed: 1249.5

Tested in IAW 14 CFR 91.411 and 91.413, this date, and found the dual pitot and dual static systems, the dual altimeters, the transponders, and the pressure reporting device meet the requirements of 14 CFR Part 43 appendices E and F. The aircraft systems were tested to an altitude of 25,000 ft. ADS-B Out performance was not tested at this time

See W/O A7451 for additional details of work performed

I certify that the above stated maintenance and/or inspection was performed in accordance with the current regulations of the Federal Aviation Administration and the aircraft is returned to service with respect to the work performed as described above.

SIGNATURE TECHNICAIR - FRESNO

FAA CRS CQDR029K

YEAR
20 _____
DATE

RECORDING
TACH
TIME

TODAY'S
FLIGHT

TOTAL
TIME IN
SERVICE

Description of Inspections, Tests, Repairs and Alterations

Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)



S I G N A T U R E
TECHNICAIR™

Aircraft Maintenance

A BBA Aviation company

SIGNATURE TECHNICAIR, FRESNO, CA.

(559)251-3794

RS CQDR029K

N624TE

03/10/2022

AIRCRAFT TOTAL TIME

5,249.5

AIRCRAFT S/N

TH-1588

HOBBS

5,249.5

Pressure lubricated both engine throttle, mixture and propeller control cables. Installed new alternator fail sensors left S/N 80V62805 and right S/N 80V62802.

Work order # S8895

Bruce R. Dwyer

SIGNATURE TECHNICAIR, 4885 E. SHIELDS, FRESNO, CA. 93726 FAA RS CQDR029K

YEAR 20____ DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)



9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

DATE: 01/28/22

MODEL: 58

ACTT: 3862.9

HOBBS: 1240.9

REG: N624TE

S/N: TH-1588

1 REMOVE & REPLACE R/H FUEL BOOST PUMP P/N: 4404-00-7 S/N: 2266 (OVERHAULED BY AEROMOTORS, LLC UNDER WORK ORDER # M2112140 DATED 01/11/22) & O-RINGS P/N: MS28778-8.


RAPHAELO LOPEZ - A&P 2709706

PERTINENT DETAILS ON FILE: W.O. 624012822

YEAR 20____ DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
------------------------	---------------------------	-------------------	-----------------------------	---



9519 Airport Drive, Hanger 19
 Visalia, CA 93277

Airframe

DATE: 12/10/21 MODEL: 58 ACTT: 3852.9 HOBBS: 1230.9
 REG: N624TE S/N: TH-1588

1 REMOVE & REPLACE AIRCRAFT BATTERY P/N: G-25 S/N: G03064607 & SERVICED WITH 4 QUARTS OF BATTERY ACID.


 RAPHAEL LOPEZ - A&P 2709706

PERTINENT DETAILS ON FILE: W.O. 624121021

YEAR 20____ DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
------------------------	---------------------------	-------------------	-----------------------------	---



9519 Airport Drive, Hanger 19
 Visalia, CA 93277

Airframe

DATE: 07/01/21 MODEL: 58 ACTT: 3816.6 HOBBS: 1193.3
 REG: N624TE S/N: TH-1588

ANNUAL INSPECTION COMPLETED THIS DATE. ALL APPLICABLE AD'S CHECKED AND CW OR N/A AS LISTED IN AD LOG. I CERTIFY THAT THIS AIRFRAME WAS INSPECTED IN ACCORDANCE WITH **ANNUAL** INSPECTION AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION. APPROVED FOR RETURN TO SERVICE.


 STEPHEN STEWART - IA 2129169

PERTINENT DETAILS ON FILE: W.O. 624070121

YEAR 20____ DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
------------------------	---------------------------	-------------------	-----------------------------	---



9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

DATE: 07/01/21 MODEL: 58 ACTT: 3816.6 HOBBS: 1193.3
 REG: N624TE S/N: TH-1588

- 11 REMOVE & REPLACE L/H & R/H MAIN TIRE'S P/N: 658C86-4, TUBE'S P/N: 6.50/7.00-8 & WHEEL SPACER P/N: 067-03400.
- 12 REMOVE & REPLACE NOSE TIRE P/N: 505C66-5, TUBE P/N: GL-05-0500 & GROMMET P/N: 217-00100.
- 13 REMOVE & REPLACE TAIL NAV LIGHT BULB P/N: 34-0428070-64.
- 14 REMOVE & REPLACE L/H NAV LIGHT BULB P/N: WL+A-7512-24.
- 15 REMOVE & REPLACE BOTH ROTATING BEACON WITH NEW LED UNITS P/N: 01-0790724-19 & 01-0790724-14.
- 16 REMOVE & REPLACE HEATED FUEL VENT P/N: 60-381002.


RAPHAEL LOPEZ - A&P 2709706

PERTINENT DETAILS ON FILE: W.O. 624070121

YEAR

20

DATE



9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

DATE: 07/01/21

MODEL: 58

ACTT: 3816.6

HOBBS: 1193.3

REG: N624TE

S/N: TH-1588

- 1 CW AD 2004-25-16R1 BY LEAK CHECK OF FUEL REGULATOR SHUT OFF VALVE, NEXT DUE 07/2022.
 - 2 CW AD 2017-16-01 BY INSP & OP'S CHECK OF AMERIKING ELT, NEXT DUE 07/2022.
 - 3 CW AD 2004-21-05 BY REPLACEMENT OF NEW HEATER ASSY P/N: 81D94-3 S/N: 10813001-F OVERHAULED BY AIRCRAFT HEATING & ELECTRICAL, INC. UNDER WORK ORDER # 18937IS/22029 DATED 06/18/21.
 - 4 REMOVE & REPLACE R/H O.B. WHEEL BEARING P/N: 13889 & RACE P/N: 13836.
 - 5 REMOVE & REPLACE NOSE WHEEL BEARING P/N: 08231 & RACE P/N: 08125
 - 6 RESEAL L/H BRAKE CALIPER WITH REPLACEMENT OF (3) O-RING'S P/N: MS28775-132.
 - 7 REMOVE & REPLACE ALL (12) BRAKE PADS P/N: 066-09700.
 - 8 REMOVE & REPLACE L/H & R/H BRAKE DISC P/N: 164-06106.
 - 9 REMOVE & REPLACE ELT BATTERIES P/N: 11-16278 (EXP. 02/2026)
 - 10 INSPECTED ELT IN ACCORDANCE WITH FAR 91.207(D). (BATTERY DUE 02/2026).
- PITOT / STATIC NEXT DUE: JUNE 2022.
 - O2 BOTTLE HYDRO NEXT DUE: MAY 2025.

RAPHAEL LOPEZ - A&P 2709706

YEAR

20

DATE

RECORDING TACH TIME

TOT FLY

DATE: 07/01/21

REG: N624TE

11 REM

P/N

12 RE

13 RE

14 RE

15 R

16 F

YEAR 20____ DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
------------------------	---------------------------	-------------------	-----------------------------	---



9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

DATE: 01/06/21 MODEL: 58 ACTT: 3803.7 HOBBS: 1181.7

REG: N624TE S/N: TH-1588

1 REPAIRED BROKEN WIRE TO SQUAT SWITCH ON R/H GEAR.

[Handwritten Signature]
 CHRISTIAN MUNOZ - A&P 3559458

RAPHAEL LOPEZ - A&P 2709706

PERTINENT DETAILS ON FILE: W.O. 624010621

--	--	--	--	--

YEAR 20____ DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician Repair Facility. (See back pages for other specific entries.)
------------------------	---------------------------	-------------------	-----------------------------	---



9519 Airport Drive, Hanger 19
 Visalia, CA 93277

Airframe

DATE: 07/23/20 MODEL: 58 ACTT: 3737.0 HOBBS: 1115.0
 REG: N624TE S/N: TH-1588

1 SERVICE A/C WITH 1.5 POUNDS OF R-12 FREON.

[Signature]
 CHRISTIAN MUÑOZ - A&P 3559458

PERTINENT DETAILS ON FILE: W.O. 624072320
