

N130F
Book #3

AIRCRAFT LOG
AF5-1

The GILL Battery Log
RECOMMENDED PRACTICES FOR
MAINTAINING THE BEST POSSIBLE CARE

2.4

INSPECTION RECORD

F.A.R. 43.11-91.409

KIND OF INSPECTION-STATUS & DISCREPANCY LIST
SIGNATURE — CERT. NO. OF PERSON APPROVING OR DISAPPROVING AIRCRAFT FOR SERVICE

DATE

AIRCRAFT TIME
IN SERVICE

Aircraft Registration: N624TE

I certify that ATC Transponder(s) has/have been inspected, tested and found to comply with FAR 43, Appendix F.

Transponder No. 1 Serial No.: 3EG028350

Transponder No. 2 Serial No.: _____

I certify that the Altimeter(s) Automatic Pressure Altitude Reporting System(s) and Static Pressure System(s) have been inspected, tested and found to comply with FAR Part 43, Appendix E.

Altimeter(s) tested to: 18,000 FT

Pilot Altimeter Serial No.: _____

Co-Pilot Altimeter Serial No.: _____

Signature: *Cyrt. [Signature]*

Date: 6/2/2020

Additional Details under work order number: 20-022

AMS Avionics Inc. CRS 7AXR408B Tel. (559) 651-0190
9504 W. Airport Drive, Visalia, CA 93277

TELEDYNE BATTERY PRODUCTS
840 W. BROCKTON AVENUE

INSPECTION RECORD F.A.R. 43.11-91.409

DATE
AIRCRAFT TIME
IN SERVICE

KIND OF INSPECTION—STATUS & DISCREPANCY LIST
SIGNATURE — CERT. NO. OF PERSON APPROVING OR DISAPPROVING AIRCRAFT FOR SERVICE



9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

DATE: 06/02/20

MODEL: 58

ACTT: 3715.3

HOBBS: 1092.0

REG: N624TE

S/N: TH-1588

ANNUAL INSPECTION COMPLETED THIS DATE. ALL APPLICABLE AD'S CHECKED AND CW
OR N/A AS LISTED IN AD LOG. I CERTIFY THAT THIS AIRFRAME WAS INSPECTED IN ACCORDANCE
WITH ANNUAL INSPECTION AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION.
APPROVED FOR RETURN TO SERVICE.


STEPHEN STEWART - IA 2129169

PERTINENT DETAILS ON FILE: W.O. 130060220

INSPECTION RECORD
F.A.R. 43.11-91.409



9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

DATE: 06/02/20

MODEL: 58

ACTT: 3715.3

HOBBS: 1092.0

REG: N624TE

S/N: TH-1588

- 1 REMOVE & REPLACE L/H & R/H BRAKE LININGS P/N: 066-09700.
- 2 REMOVE & REPLACE L/H MAIN WHEEL BEARINGS P/N: 13889 & RACES P/N: 13836
- 3 REMOVE & RE-INSTALL L/H & R/H PROP GOVERNORS AFTER BENCH TEST PERFORMED BY WEST COAST GOVERNOR SERVICE, UNDER WORK ORDER # 1728 DATED 05/21/20.
- 4 REMOVE L/H WING FUEL VENT CHECK VALVE, CLEAN AND RE-INSTALL.
- 5 REMOVE & REPLACE AIR ELEMENT FILTER'S P/N: BA-7705.
- 6 REMOVE & REPLACE(4) L/H BRAKE ASSY PIN P/N: 07-20187.
- 7 REMOVE & REPLACE L/H & R/H BRAKE ASSY'S P/N: 068-02700
- 8 REMOVE & REPLACE BEACON LIGHT BULB P/N: A7079B-24.
- 9 REMOVE & REPLACE (2) STATIC WICK P/N: 101-380053-11
- 10 REMOVE & REPLACE (4) ELT BATTERIES.
- 11 INSPECTED ELT IN ACCORDANCE WITH FAR 91.207(D). *(BATTERY DUE 03/2028).*
 - *PITOT / STATIC NEXT DUE: JUNE 2022.*
 - *O2 BOTTLE HYDRO NEXT DUE: MAY 2025.*


STEPHEN STEWART - A&P 2129169

PERTINENT DETAILS ON FILE: W.O. 130060220

INSPECTION RECORD F.A.R. 43.11-91.409

KIND OF INSPECTION-STATUS & DISCREPANCY LIST

SIGNATURE — CERT. NO. OF PERSON APPROVING OR DISAPPROVING AIRCRAFT FOR SERVICE

DATE

AIRCRAFT TIME
IN SERVICE



9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

DATE: 10/30/19

MODEL: 58

ACTT: 3657.4

HOBBS: 1034.1

REG: N624TE

S/N: TH-1588

1 INSTALL NEW RIGHT MAIN TIRE P/N: 658C86-4 AND INNER TUBE P/N: GL6515B


CHRISTIAN MUNOZ - A&P 3559458

PERTINENT DETAILS ON FILE: W.O. 624103019



9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

DATE: 12/5/19

MODEL: 58

ACTT: 3671.5

HOBBS: 1048.2

REG: N624TE

S/N: TH-1588

1 INSTALL 3 NEW SLIP RING WIRE HARNESSSES P/N: 3H2113


RAPHAEL LOPEZ - A&P 2709706

PERTINENT DETAILS ON FILE: W.O. 624120519

TELEDYNE BATTERY PRODUCTS

840 W. BROCKTON AVENUE

REDLANDS, CA 92371



9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

DATE: 7/24/19

MODEL: 58

ACTT: 3623.30

HOBBS: 1000.0

REG: N624TE

S/N: TH-1588

- 1 REMOVE & REPLACE RH LENS COVER PN: LP-150CL
- 2 SERVICE A/C SYSTEM W/ 2LBS OF R-12 FREON.


CHRISTIAN MUNOZ - A&P 3559458

PERTINENT DETAILS ON FILE: W.O. 624062419



9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

DATE: 10/23/19

MODEL: 58

ACTT: 3651.8

HOBBS: 1028.5

REG: N624TE

S/N: TH-1588

- 1 INSTALL NEW LED TAXI LIGHT P/N: 01-0771833-25


CHRISTIAN MUNOZ - A&P 3559458

PERTINENT DETAILS ON FILE: W.O. 624102319



9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

DATE: 6/12/19

MODEL: 58

ACTT: 3616.2

HOBBS: 992.9

REG: N624TE

S/N: TH-1588

- 1 REMOVE & REPLACE PROP SYNC SWITCH PN: 213699 , SN:1571742D TO BE TESTED AT AIRCRAFT SYSTEMS INC. UNDER WO#53178.
- 2 N-NUMBER CHANGE FROM N130S TO N624TE.
- 3 REMOVE & REPLACE PROP CONTROL KNOB PN: 50-824806-3.


RAPHAEL LOPEZ - A&P 2709706

- 4 ADJUST ELEVATOR TRIM TAB WITHIN TOLERANCE.


CHRISTIAN MUNOZ - A&P 3559458

PERTINENT DETAILS ON FILE: W.O. 624061219



9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

DATE: 7/22/19

MODEL: 58

ACTT: 3623.30

HOBBS: 1007.7

REG: N624TE

S/N: TH-1588

- 1 REMOVE & REPLACE LEFT LENS COVER P/N: LP-149CL


CHRISTIAN MUNOZ - A&P 3559458

PERTINENT DETAILS ON FILE: W.O. 624072219

DAT

TELEDYNE BATTERY PRODUCTS
840 W. BROCKTON AVENUE
REDLANDS, CA 92374
www.gilbatteries.com

INSPECTION RECORD

F.A.R. 43.11-91.409

DATE
AIRCRAFT TIME
IN SERVICE

KIND OF INSPECTION-STATUS & DISCREPANCY LIST
SIGNATURE — CERT. NO. OF PERSON APPROVING OR DISAPPROVING AIRCRAFT FOR SERVICE



9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

DATE: 4/1/19

MODEL: 58

ACTT: 3591.3

HOBBS: 968.0

REG: N130S

S/N: TH-1588

ANNUAL INSPECTION COMPLETED THIS DATE. ALL APPLICABLE AD'S CHECKED AND CW OR N/A AS LISTED IN AD LOG. I CERTIFY THAT THIS AIRFRAME WAS INSPECTED IN ACCORDANCE WITH **ANNUAL** INSPECTION AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION.

APPROVED FOR RETURN TO SERVICE.


STEPHEN STEWART - IA 2129169

PERTINENT DETAILS ON FILE: W.O. 130040119

**INSPECTION RECORD
F.A.R. 43.11-91.409**

DATE



9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

DATE: 4/1/19 MODEL: 58 ACTT: 3591.3 HOBBS: 968.0
REG: N130S S/N: TH-1588

- 11 REMOVE & REPLACE LDG CIRCUIT BREAKER PN:7271-8-30.
- 12 CLEAN & UNCLOG ALL WING BOLT DRAINS.
- 13 REMOVE & REPLACE LDG LH & RH ANTI-ICE BOOT ASSY PN:60-810097-5.
- 14 REMOVE & REINSTALL RIGHT STROBE LIGHT LENS COVER PN:TR-25-0491-1.
- 15 WASHER ADDED TO LANDING GEAR ACTUATOR HANDCRANK PN:35-810134-1.
- 16 REMOVE & REPLACE TOP LH AFT WING BOLT COVER CLIP INBOARD PN:35-105005-6.


CHRISTIAN MUÑOZ - A&P 3559458

- 17 REMOVE & REPLACE DOWN POSITION FLAPS MICRO SWITCH PN:MS25008-1.
- 18 C/W AD 2004-21-05 PRESSURE DECAY TEST (PASSED).


RAPHAEL LOPEZ - A&P 2709706

- 19 C/W AD 2004-25-16 R1 FUEL REGULATOR SHUT OFF VALVE.
- 20 AIRCRAFT REPAINTED BY POTTS PAINTING IN SALINAS, CA. AIRCRAFT REGISTRATION NUMBER CHANGE APPLICATION PENDING FOR N130S TO N624TE.


STEPHEN STEWART - A&P 2129169

PERTINENT DETAILS ON FILE: W.O. 130040119

DATE

AIR

DATE
REG:

TELEDYNE BATTERY PRODUCTS
840 W. BROCKTON AVENUE

INSPECTION RECORD

F.A.R. 43.11-91.409

AIRCRAFT TIME

KIND OF INSPECTION-STATUS & DISCREPANCY LIST



9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

DATE: 4/1/19

MODEL: 58

ACTT: 3591.3

HOBBS: 968.0

REG: N130S

S/N: TH-1588

- 1 INSTALL NEW ELEMENT PN:BA-7705.
- 2 REMOVE & REPLACE LH MAIN WHEEL BEARING PN:13889 & RACE PN:13836.
- 3 REMOVE & REPLACE TOW PIN NOSE STRUT ASSY PN:RA60-820029-1.
- 4 REMOVE & REPLACE 2 MAIN GEAR SHEAR PINS PN:60-810082-3
& NOSE GEAR SHEAR PINS PN:MS20392-2C29.
- 5 REMOVE & REPLACE 2 UPLOCK ROLLERS PN:YAG-06-E, 2 BOLTS PN:60-810026-53,
& 2 BUSHINGS PN:60-810040.
- 6 REMOVE & REPLACE RIGHT MAIN GEAR BRAZED ASSY ROD PN:35-815125-14.
WITH 2 BOLTS PN:130909B66 & 130909B99.
- 7 REMOVE & REPLACE 2 FUEL CAP O-RINGS PN:MS28775-338.
- 8 REMOVE & REPLACE 8 RIVNUTS AT RIGHT WING LEADING EDGE BOTTOM INBOARD.
- 9 INSTALL WING ROOT SEAL PN:05-00668 & TAIL ROOT SEAL PN:05-00669.
- 10 INSPECTED ELT IN ACCORDANCE WITH FAR 91.207(D) (DUE 8/2020).


CHRISTIAN MUÑOZ - A&P 3559458

PERTINENT DETAILS ON FILE: W.O. 130040119

INSPECTION RECORD F.A.R. 43.11-91.409

DATE

AIRCRAFT TIME
IN SERVICE

KIND OF INSPECTION—STATUS & DISCREPANCY LIST
SIGNATURE — CERT. NO. OF PERSON APPROVING OR DISAPPROVING AIRCRAFT FOR SERVICE



9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

DATE: 11/01/18

MODEL: 58

ACTT: 3590.1

HOBBS: 966.8

REG: N130S

S/N: TH-1588

1 INSTALL OVERHAULED LEFT TACHOMETER P/N: 102-380011-25, S/N: 777.


RAPHAEL LOPEZ - A&P 2709706

INSTALL NEW WINDSHIELD P/N: LP269 WITH SOLAR TINT USING 32 CHERRY RIVETS P/N: CR3213-4-03,
AND 2 TUBES OF PRC SEALANT P/N: CS-3204B-1/2.


BYRON VANDER WEIDE - A&P 3681179


DARRELL TUNNELL - A&P 3275726

PERTINENT DETAILS ON FILE: W.O. 130112618

TELEDYNE BATTERY PRODUCTS
840 W. BROCKTON AVENUE

DATE



9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

DATE: 06/20/18

MODEL: 58

ACTT: 3512.8

HOBBS: 889.5

REG: N130S

S/N: TH-1588

1 REMOVE & REPLACE L/H MAIN TIRE PN: 658C86-4 & BALANCE.

RAPHAEL LOPEZ - A&P 2709706

PERTINENT DETAILS ON FILE: W.O. 130062018

005

INSPECTION RECORD F.A.R. 43.11-91.409

DATE

AIRCRAFT TIME
IN SERVICE

KIND OF INSPECTION—STATUS & DISCREPANCY LIST
SIGNATURE — CERT. NO. OF PERSON APPROVING OR DISAPPROVING AIRCRAFT FOR SERVICE



9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

DATE: 06/18/18 MODEL: 58 ACTT: 3510.6 HOBBS: 887.3
REG: N130S S/N: TH-1588

- 1 REMOVE & REPLACE VACUUM PUMP P/N:442CW-12 S/N:179553 ON L/H ENGINE.
- 2 REMOVE & REPLACE BOTH LIGHT BULBS P/N:WL-A-7079B-24 ON LOWER ROTATING BEACON.
- 3 REMOVE & REPLACE FWD LIGHT BULB ON UPPER ROTATING BEACON.
- 4 REMOVE & REPLACE R/H NAV LIGHT BULB P/N:WL-A-7512-24.

- 5 SERVICE A/C SYSTEM WITH 1 LBS OF R12 FREON.


RAPHAEL LOPEZ - A&P 2709706


CHRISTIAN MUNOZ - A&P 3559458

PERTINENT DETAILS ON FILE: W.O. 130061818

TELEDYNE BATTERY PRODUCTS
840 W. BROCKTON AVENUE
REDLANDS, CA 92374

INSPECTION RECORD
F.A.R. 43.11-91.409

AIRCRAFT TIME

KIND OF INSPECTION-STATUS & DISCREPANCY LIST

DATE



9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

DATE: 05/17/18

MODEL: 58

ACTT: 3496.4

HOBBS: 873.1

REG: N130S

S/N: TH-1588

- 1 REMOVE & REPLACE R/H STARTER RELAY P/N:6041H190.
- 2 REMOVE & REPLACE AIRCRAFT BATTERIES P/N:G-25 S/N:G02961263 & G03000106.


RAPHAEL LOPEZ - A&P 2709706

PERTINENT DETAILS ON FILE: W.O. 130051718

- 1) For a period of six, twelve, 300 hours or 600 hours, or the date of installation, twelve months or supplied by TBP to be defective in material or workmanship, TBP will replace any battery made under this paragraph, the replacement battery which will equal the original battery in type and performance. The warranty period for the battery has been in service for the warranty period and then the number of hours on the replaced battery has been in service, or recorded tachometer hours from the warranty period as specified above. TBP will not assume any response costs in connection with the repair warranty.
- 2) After the expiration of the period described above and before the battery type in question or the battery will replace any battery made under this paragraph, the replacement battery which will equal the original battery in type and performance. The warranty period for the battery has been in service for the warranty period and then the number of hours on the replaced battery has been in service, or recorded tachometer hours from the warranty period as specified above. TBP will not assume any response costs in connection with the repair warranty.
- 3) This warranty applies only to the manufacturer's inspection, maintenance and recommended inspection and maintenance appropriate logbook entries.
- 4) This warranty does not apply to any TBP which has been subjected to which has been installed, repaired or way that in the judgment of TBP has of the battery or which has been recommended.
- 5) This warranty does not apply to recommendations by TBP has been used markings have been destroyed, or than that specified by the aircraft manufacturer. The provisions of this warranty do not apply to any battery sold.
- 6) TBP reserves the right to change any without incurring any responsibility for sold.
- 7) THE SOLE AND EXCLUSIVE REMEDY IS LIMITED TO REPLACEMENTS SPECIFICALLY, BUT WITHOUT LIABILITY, IMPLIED WARRANTIES OF MERCHANTABILITY FOR A PARTICULAR PURPOSE. TBP IS RESPONSIBLE FOR ANY DAMAGES ARISING OUT OF THE FAILURE OF PROPERTY OR ARISING OUT OF

Blow a _____
 Chang _____
 Check _____
 Check _____
 DO N _____
 DO N _____
 Cove _____
 Chec _____
 Com _____
 Cus _____
 ple _____
 ,inc _____
 IRC _____

DATE: 1/09/18 MODEL: 58
 REG: N130S S/N: TH-1588

ACTT: 3433.0 HOBBS: 809.7

1 REPAIR BROKEN WIRE ON PROP SYNC ON L/H ENGINE

Airframe

9519 Airport Drive, Hanger 19
 Visalia, CA 93277

PERTINENT DETAILS ON FILE: W.O. 130010918

RAPHAEL LOPEZ - A&P 2709706
 CHRISTIAN MUNOZ - A&P 3559458


 9519 Airport Drive, Hanger 19
 Visalia, CA 93277

DATE: 02/09/18 MODEL: 58
 REG: N130S S/N: TH-1588

ACTT: 3442.3 HOBBS: 819.0

1 REMOVE & REPLACE R/H MAIN TIRE P/N:658C86-4 & BALANCE.

Airframe

PERTINENT DETAILS ON FILE: W.O. 130020918

CHRISTIAN MUNOZ - A&P 3559458

INSPECTION RECORD


F.A.R. 43.11-91.409

DATE _____ AIRCRAFT TIME IN SERVICE _____ KIND OF INSPECTION—STATUS & DISCREPANCY LIST _____
SIGNATURE — CERT. NO. OF PERSON APPROVING OR DISAPPROVING AIRCRAFT FOR SERVICE _____

10 REMOVE & REPLACE BOTH MIXTURE CONTROL KNOBS P/N:50-524504-3.


RAPHAEL LOPEZ - A&P 2709706

11 REMOVE & REPLACE R/H ENGINE EGT PROBE P/N:59180.


CHRISTIAN MUNOZ - A&P 3559458

PERTINENT DETAILS ON FILE: W.O. 130110117



9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

DATE: 11/01/17

MODEL: 58

ACTT: 3409.3

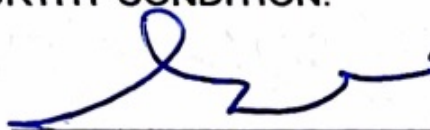
HOBBS: 786.0

REG: N130S

S/N: TH-1588

ANNUAL INSPECTION COMPLETED THIS DATE. ALL APPLICABLE AD'S CHECKED AND C/W OR N/A AS LISTED IN AD LOG. I CERTIFY THAT THIS AIRFRAME WAS INSPECTED IN ACCORDANCE WITH ANNUAL INSPECTION AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION.

APPROVED FOR RETURN TO SERVICE.


STEPHEN STEWART - IA 2129169

PERTINENT DETAILS ON FILE: W.O. 130110117

10) This warranty is limited to replacement of a GILL Battery only.
WARRANTY ARISING OUT OF ANY DEFECT IN ANY BATTERY ARISING OUT OF THE FAILURE OF ANY BATTERY TO OPERATE PROPERLY, OR ARISING OUT OF ANY BREACH OF THE WARRANTY MADE HEREIN. No person is authorized to give any other warranty or to assume any additional obligation or liability on behalf of TBP.

INSPECTION RECORD



9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

DATE: 11/01/17 MODEL: 58 ACTT: 3409.3 HOBBS: 786.0


REG: N130S S/N: TH-1588

- 1 C/W A.D. 2017-16-01 OP'S CHECK ELT AS PER CONT. AIRWORTHINESS INSTRUCTION MANUAL.
 - 2 REMOVE & REINSTALL OXYGEN CYLINDER & REGULATOR ASSY PN: 801977-13 SN: L631808 /946 /1074 AFTER OVERHAUL & HYDRO STATIC TEST PERFORMED BY C&L AERO UNDER WORK ORDER # 10253.
 - 3 REMOVE & REPLACE BEARING P/N:13889 & RACE P/N:13836 ON L/H & R/H MAIN WHEEL.
 - 4 REMOVE & REPLACE BRAKE DISC'S P/N:164-06106 & LININGS P/N:066-09700.
 - 5 REMOVE & REPLACE ALTERNATORS P/N:R-649304 S/N: O15GA091R, O15GA092R, O15GA093R, O15GA094R, O15GA095R & O15GA096R
 - 6 PAINT INSIDE OF ENGINE COWLING.
 - 7 INSPECTED ELT IN ACCORDANCE WITH FAR 91.207(D). (BATTERY DUE AUGUST 2020).
- PITOT / STATIC NEXT DUE: SEPTEMBER 2018.
 - O2 BOTTLE HYDRO NEXT DUE: OCTOBER 2020.


STEPHEN STEWART - A&P 2129169

- 8 REMOVE & RE-INSTALL L/H PROP GOVERNOR PN: B210800 SN: 2246281 AFTER OVERHAUL BY WEST COAST GOVERNOR SERVICE UNDER WORK ORDER # 1740
- 9 REMOVE & RE-INSTALL R/H PROP GOVERNOR PN: B210800 SN: 2246272 AFTER OVERHAUL BY WEST COAST GOVERNOR SERVICE UNDER WORK ORDER # 1740


RAPHAEL LOPEZ - A&P 2709706


CHRISTIAN MUNOZ - A&P 3559458

JMP

No

Blow al

Chang

Check

Check

DO NO

DO NO

Cover

Check

Comp

Cust

plete

inc.
AIRCRA

DATE

AI

10

11

INSPECTION RECORD F.A.R. 43.11-91.409

DATE

AIRCRAFT TIME
IN SERVICE

KIND OF INSPECTION-STATUS & DISCREPANCY LIST

SIGNATURE — CERT. NO. OF PERSON APPROVING OR DISAPPROVING AIRCRAFT FOR SERVICE



9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

DATE: 09/27/16

MODEL: 58

ACTT: 3317.3

HOBBS: 694.0

REG: N130S

S/N: TH-1588

ANNUAL INSPECTION COMPLETED THIS DATE. ALL APPLICABLE AD'S CHECKED AND C/W OR N/A AS LISTED IN AD LOG. I CERTIFY THAT THIS AIRFRAME WAS INSPECTED IN ACCORDANCE WITH ANNUAL INSPECTION AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION.

APPROVED FOR RETURN TO SERVICE.

STEPHEN STEWART - IA 2129169

PERTINENT DETAILS ON FILE: W.O. 130092716

DAMAGES ARISING OUT OF ANY DEFECT IN ANY BATTERY, ARISING OUT OF THE FAILURE OF ANY BATTERY TO OPERATE PROPERLY, OR ARISING OUT OF ANY BREACH OF THE WARRANTY MADE HEREIN. No person is authorized to give any

INSPECTION RECORD

F.A.R. 43.11-91.409

DATE

AIRCRAFT TIME
IN SERVICEKIND OF INSPECTION-STATUS & DISCREPANCY LIST
SIGNATURE — CERT. NO. OF PERSON APPROVING OR DISAPPROVING AIRCRAFT FOR SERVICE9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

DATE: 09/27/16 MODEL: 58 ACTT: 3317.3 HOBBS: 694.0
REG: N130S S/N: TH-1588

1 CW AD 2004-25-16R1 HEATER REGULATOR LEAK CHECK.

- PITOT / STATIC NEXT DUE: SEPTEMBER 2018.
- O2 BOTTLE HYDRO NEXT DUE: AUGUST 2017.

STEPHEN STEWART - A&P 2129169

2 CW AD 2004-21-05 PRESSURE DECAY TEST ON ACFT HEATER.

RAPHAEL LOPEZ - A&P 2709706

- 3 REMOVE & REPLACE NOSE WHEEL BEARING P/N# 08125, & RACE P/N# 08231
- 4 RE-SEAL NOSE STRUT WITH O-RINGS P/N#M83461-1-011, P/N# M83461-1-226, P/N# MS28774-327, & MS3461-1-327, & SEAL THREAD P/N#750-000-3/8.
- 5 REPLACE SCISSOR LINK NOSE BUSHING P/N# 06DU08 & P/N# 06DU03, BOLT P/N#AN175-174, HARDWARE P/N# 105739X-YG0820, & END BOLT P/N# AN6-36.
- 6 ADJUST LANDING GEAR UPLOCK ROLLERS.

CHRISTIAN MUNOZ - A&P 3559458

PERTINENT DETAILS ON FILE: W.O. 130092716

INSPECTION RECORD

F.A.R. 43.11-91.409

AIRCRAFT TIME
IN SERVICE

KIND OF INSPECTION—STATUS & DISCREPANCY LIST
SIGNATURE — CERT. NO. OF PERSON APPROVING OR DISAPPROVING AIRCRAFT FOR SERVICE

Aircraft Registration: 1305

I certify that ATC Transponder(s) has/have been inspected, tested and found to comply with FAR 43, Appendix F.

Transponder No. 1 Serial No.: (GTX330) 84124976

Transponder No. 2 Serial No.: (GTX327) 83727203

I certify that the Altimeter(s) Automatic Pressure Altitude Reporting System(s) and Static Pressure System(s) have been inspected, tested and found to comply with FAR Part 43, Appendix E.

Altimeter(s) tested to: 20,000 FT

Pilot Altimeter Serial No.: _____

Co-Pilot Altimeter Serial No.: _____

Signature: *Clyde Murray*

Date: 09/26/2016

Additional Details under work order number: 16-235

AMS Avionics Inc. CRS 7AXR408B Tel. (559) 651-0190
9504 W. Airport Drive, Visalia, CA 93277

INSPECTION RECORD
F.A.R. 43.11-91.409



9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

ACTT: 3281.6

HOBBS: 658.3

DATE: 06/28/16

MODEL: 58

REG: N130S

S/N: TH-1588

- 1 INSTALL VACUUM PUMP P/N: 442CW-12 S/N: 163554.
- 2 INSTALL VACUUM FILTER P/N: AA254-7.


RAPHAEL LOPEZ - A&P 2709706

PERTINENT DETAILS ON FILE: W.O. 130062816



9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

ACTT: 3294.3

HOBBS: 671.0

DATE: 07/27/16

MODEL: 58

REG: N130S

S/N: TH-1588

- 1 TROUBLESHOOT LEAK IN A/C SYSTEM. SYSTEM W/ 3 LBS OF R-12. GROUND RUN CHECKS GOOD.
- 2 REPLACE L/R MAIN GEAR TIRES P/N: P/N: 658C86-4, TUBES P/N: 302-247-400, RACES P/N: 13836, BEARINGS P/N: 13889, AND BALANCED WHEELS.
- 3 REPLACE NOSE TIRE P/N: 505C66-5, TUBE P/N: 302-013-400, AND BALANCED WHEEL.


CHRISTIAN MUNOZ - A&P 3559458

PERTINENT DETAILS ON FILE: W.O. 130072716

INSPECTION RECORD F.A.R. 43.11-91.409

KIND OF INSPECTION—STATUS & DISCREPANCY LIST
SIGNATURE — CERT. NO. OF PERSON APPROVING OR DISAPPROVING AIRCRAFT FOR SERVICE

AIRCRAFT TIME
IN SERVICE

DATE

AMS AVIONICS, INC.

9504 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

DATE: 9/30/15 MODEL: 58
REG: N130S S/N: TH-1588

HOBBS:

- 1 REMOVE AND REINSTALLED GARMIN GTX330 P/N: 011-00455-00, S/N: 84124976 TRANSPONDER AFTER REPAIRS BY GARMIN INTERNATIONAL UNDER WORK ORDER NUMBER 82335325.
- 2 INSTALL NEW ENCOSER.
- 3 REMOVE AND REINSTALL VERTICAL SPEED INDICATOR P/N: 704C.18, S/N: 5D992 AFTER REPAIRS BY MID CONTINENT INSTRUMENTS UNDER WORK ORDER NUMBER 200839818.
- 4 REMOVE AND REINSTALL AIRSPEED INDICATOR P/N: 8030-B.558, S/N: 137972 AFTER REPAIRS BY MID CONTINENT INSTRUMENTS UNDER WORK ORDER NUMBER 200839818.
- 5 MID CONTINENT INSTRUMENTS UNDER WORK ORDER NUMBER 200839818.


KIRK KILLIAN

PERTINENT DETAILS ON FILE: W.O. 15-274

REPAIR STATION NUMBER 7AXR408B

INSPECTION RECORD

F.A.R. 43.11-91.409

DATE	AIRCRAFT TIME IN SERVICE	KIND OF INSPECTION-STATUS & DISCREPANCY LIST SIGNATURE — CERT. NO. OF PERSON APPROVING OR DISAPPROVING AIRCRAFT FOR SERVICE



9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

DATE: 08/26/15

MODEL: 58

ACTT: 3180.3

HOBBS: 557.0

REG: N130S

S/N: TH-1588

ANNUAL INSPECTION COMPLETED THIS DATE. ALL APPLICABLE AD'S CHECKED AND C/W OR N/A AS LISTED IN AD LOG. I CERTIFY THAT THIS AIRFRAME WAS INSPECTED IN ACCORDANCE WITH ANNUAL INSPECTION AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION. APPROVED FOR RETURN TO SERVICE.


STEPHEN STEWART - IA 2129169

PERTINENT DETAILS ON FILE: W.O. 130082615

INSPECTION RECORD

F.A.R. 43.11-91.409

KIND OF INSPECTION—STATUS & DISCREPANCY LIST
SIGNATURE — CERT. NO. OF PERSON APPROVING OR DISAPPROVING AIRCRAFT FOR SERVICE

AIRCRAFT TIME
IN SERVICE

DATE



9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

DATE: 08/26/15

MODEL: 58

ACTT: 3180.3

HOBBS: 557.0

REG: N130S

S/N: TH-1588

- 1 AD 2004-25-16R1 HEATER REGULATOR LEAK CHECK. NOT DUE AT THIS TIME; NEXT DUE: AUGUST 2016
- 2 AD 2004-21-05 PRESSURE DECAY TEST ON ACFT HEATER. NOT DUE AT THIS TIME; NEXT DUE AUG 2016.
- 3 REPLACE LEFT / RIGHT ENGINE BREATHER TUBES P/N: 58-910035-5 & -7.
- 4 INSTALL NEW AIR FILTER ELEMENTS P/N: BA-7705.
- 5 REPLACE ELT BATTERY P/N: 11-06686.
- 6 INSPECTED ELT IN ACCORDANCE WITH FAR 91.207(D) **DUE AUGUST 2020.**
- PITOT / STATIC NEXT DUE: **AUGUST 2016.**
- **02 BOTTLE HYDRO NEXT DUE: AUGUST 2017.**


STEPHEN STEWART - A&P 2129169

PERTINENT DETAILS ON FILE: W.O. 130082615

13a. Certifies the items identified above were manufactured in conformity to:

Approved design data and are in a condition for safe operation.

Non-approved design data specified in Block 12.

13b. Authorized Signature:

13c. Approval/Authorization No.:

13d. Name (Typed or Printed):

13e. Date (dd/mm/yy):

User/Installer Res

Date: 07-28-2015

Aircraft: N130S

Work Order: 22466


Hobbs: 549.4

The following work has been performed-

1. Replaced starter on LH engine with overhauled P/N 646275-1 from Hartzell Engine Technologies W/O: M520840.

Pertinent details of this repair are on file under the work order # listed above at SunWest Aviation, 985 Airport Drive, San Luis Obispo CA 93401 (805) 783-2359.

"All work has been accomplished in accordance with, and in reference to FAA approved data. My signature constitutes approval for return to service of this aircraft only for work I have performed. I have not been authorized to perform any inspection of this aircraft/ engine nor have I reviewed or been authorized to review the maintenance records, including 14 CFR Part 39 compliance."



Authorized Individual: Grant R. Sahl, A&P 3564911



9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

DATE: 07/14/15

MODEL: 58

REG: N130S

S/N: TH-1588

ACTT: 3166.3

HOBBS: 543.0

1 REPLACE BOTH ACFT BATTERIES P/N: G-25 S/N'S: G02865087 & G02865089
AND SERVICE WITH 2- QUARTS EACH BATTERY ACID.


RAPHAEL LOPEZ - A&P 2709706

PERTINENT DETAILS ON FILE: W.O. 130071415

**INSPECTION RECORD
F.A.R. 43.11-91.409**

DATE **AIRCRAFT TIME IN SERVICE** **KIND OF INSPECTION-STATUS & DISCREPANCY LIST**
SIGNATURE — CERT. NO. OF PERSON APPROVING OR DISAPPROVING AIRCRAFT FOR SERVICE

I certify that ATC Transponder(s) has/have been inspected, tested and found to
Complies with FAR 43, Appendix F.

Transponder No. 1 Serial No. GTX330 84124976 7.04

Transponder No. 2 Serial No. GTX377 83727203 2-10

Date: 8-22-14 Signature: [Signature]

AMS Avionics Inc. Certificate No. 7AXR408B Tel. (559) 651-0190

9504 W. Airport Dr., Visalia, Ca. 93277 N 1309

I certify that the Altimeter(s) Automatic Pressure Altitude Reporting System(s)
and Static Pressure System(s) have been inspected, tested and found to comply
With FAR Part 43, Appendix E.

Altimeter(s) tested to 20,000 FT

Pilot Altimeter Serial No. X

Co-Pilot Altimeter Serial No. X

Date: 8-22-14 Signature: [Signature]

AMS Avionics Inc. Certificate No. 7AXR408B Tel. (559) 651-0190

9504 W. Airport Dr., Visalia Ca. 93277 N 1309

INSPECTION RECORD F.A.R. 43.11-91.409

KIND OF INSPECTION—STATUS & DISCREPANCY LIST
SIGNATURE — CERT. NO. OF PERSON APPROVING OR DISAPPROVING AIRCRAFT FOR SERVICE

AIRCRAFT TIME
IN SERVICE



9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

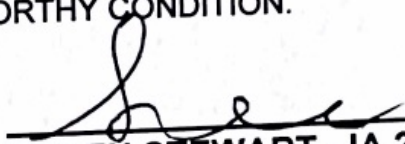
DATE: 08/21/14
REG: N130S

MODEL: 58
S/N: TH-1588

ACTT: 3060.3

HOBBS: 437.0

ANNUAL INSPECTION COMPLETED THIS DATE. ALL APPLICABLE AD'S CHECKED AND C/W OR N/A AS LISTED IN AD LOG. I CERTIFY THAT THIS AIRFRAME WAS INSPECTED IN ACCORDANCE WITH ANNUAL INSPECTION AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION. APPROVED FOR RETURN TO SERVICE.


STEPHEN STEWART - IA 2129169

PERTINENT DETAILS ON FILE: W.O. 130082114

INSPECTION RECORD

F.A.R. 43.11-91.409

DATE

AIRCRAFT TIME
IN SERVICEKIND OF INSPECTION-STATUS & DISCREPANCY LIST
SIGNATURE — CERT. NO. OF PERSON APPROVING OR DISAPPROVING AIRCRAFT FOR SERVICE

9519 Airport Drive, Hanger 19

Visalia, CA 93277

Airframe

DATE: 08/21/14 MODEL: 58

ACTT: 3060.3

HOBBS: 437.0

REG: N130S S/N: TH-1588

- 9 REPLACE PNEUMATIC FILTER P/N: AA2J4-7.
- 10 REPLACE L/R FUEL CAP ORINGS P/N: MS29513-338.
- 11 REPLACE TAXI LAMP P/N: 4626.
- 12 RE-SEAL LANDING GEAR ACTUATOR.
- 13 LUBE FLAP CABLES AND ACTUATOR.
- 14 REPAIR TWO CABIN FLOORBOARDS.


GABRIEL RAMIREZ - A&P 3130276

- 15 REMOVE AND RE-INSTALL L/H OB TAILPIPE P/N: 96-950004-5S, R/H I/B TAILPIPE P/N: 96-950004-59, FWD STACKS P/N: 96-950004-33, CENTER STACKS P/N: 96-950004-29, AND AFT STACKS P/N: 96-950004-25 AFTER REPAIRS BY KNISLEY WELDING UNDER WORK ORDER 149215.
- 16 REPLACE L/H O/B AND R/H I/B EXHAUST GASKETS P/N: SA628260.
- 17 REPLACE EXHAUST BOLTS P/N: AN3C16.


GABRIEL RAMIREZ - A&P 3130276

PAGE 2 OF 2


STEPHEN STEWART - A&P 2129169

PERTINENT DETAILS ON FILE: W.O. 130082114

INSPECTION RECORD



9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

DATE: 08/21/14

MODEL: 58

ACTT: 3060.3

HOBBS: 437.0

REG: N130S

S/N: TH-1588

- 1 AD 2013-16-01 IS N/A; WEIGHT NOT CHANGED.
- 2 C/W AD 2007-08-08 BY LUBRICATION OF UPLOCK ROLLERS. NEXT DUE: HOBBS 537.0.
- 3 C/W AD 2004-25-16R1 HEATER REGULATOR LEAK CHECK. NEXT DUE: AUGUST 2016.
- 4 REMOVE AND RE-INSTALL OXYGEN BOTTLE P/N: 801977-13 S/N: L631808 / 946 / 1074 FOR HYDROSTATIC TESTING BY C&L AERO UNDER WORK ORDER 008248.
- 5 REPLACE L/H ENGINE VACUUM PUMP P/N: 442CW-12.
- 6 INSPECTED ELT IN ACCORDANCE WITH FAR 91.207(D) **DUE AUGUST 2015.**
- * PITOT / STATIC NEXT DUE: **AUGUST 2016.**
- * O2 BOTTLE HYDRO NEXT DUE: **AUGUST 2017.**

STEPHEN STEWART - A&P 2129169

- 7 C/W AD 2004-21-05 BY INSPECTION / HEATER DECAY TEST ON ACFT HEATER. NEXT DUE IN 100 HEATER HOURS OR 24 MONTHS.

RAPHAEL LOPEZ - A&P 3130276

- 8 INSTALL NEW ENGINE CONTROL CABLES. L/H THROTTLE & R/H MIX CABLE P/N: 102-389010-33, R/H THROTTLE, L/H MIX, AND L/H PROP CABLE P/N: 102-389010-47, AND R/H PROP CABLE P/N: 102-389010-49.

GABRIEL RAMIREZ - A&P 3130276

CHRISTIAN MUNOZ - A&P 3559458

PAGE 1 OF 2

PERTINENT DETAILS ON FILE: W.O. 130082114

RECOMMENDED P/N
TAKING THE BEST POSSIBLE
OF YOUR AIRCRAFT BATTERIES

NO.
TO SERVICE

DATE

MAINTENANCE RECORD
F.A.R. 43.9

DATE OF COMPLETION	AIRCRAFT TIME IN SERVICE	DESCRIPTION OF WORK PERFORMED OR APPROVED DATA USED	AGENCY & CERTIFICATE NO. WORK PERFORMED/RETURNED TO



9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

DATE: 05/28/14 MODEL: 58 ACTT: 3077.8 HOBBS: 412.7
REG: N130S S/N: TH-1588

1 REPLACE L/R MAIN GEAR TIRES P/N: 658C86-4.

2 SERVICE ACFT A/C SYSTEM WITH 2 LBS OF R-12 FREON.


GABRIEL RAMIREZ - A&P 3130276


KENNETH TURNER - A&P 3274206

PERTINENT DETAILS ON FILE: W.O. 130052814

MAINTENANCE RECORD F.A.R. 43.9

PERCENTAGE OF COMPLETION	AIRCRAFT TIME IN SERVICE	DESCRIPTION OF WORK PERFORMED OR APPROVED DATA USED	AGENCY & CERTIFICATE NO. WORK PERFORMED/RETURNED TO SERVICE



9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

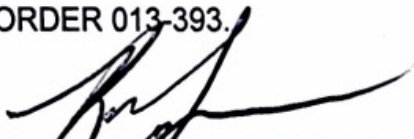
DATE: 12/05/13 MODEL: 58 ACTT: 2968.0 HOBBS: 344.7
REG: N130S S/N: TH-1588

1 REPLACE R/H VACUUM PUMP P/N: 442CW-12 S/N: 155058.


RAPHAEL LOPEZ - A&P 2709706

2 REMOVE AND RE-INSTALL PROPELLER P/N: 3AF32C512-C S/N: 952464 AFTER REPAIRS
BY JOHNSON AND SON'S PROPELLER AFTER REPAIRS UNDER WORK ORDER 013-393.

3 REPLACE R/H VACUUM PUMP FILTER P/N: AA2J4-6.


KENNETH TURNER - A&P 3274206

PERTINENT DETAILS ON FILE: W.O. 130120513

MAINTENANCE RECORD

F.A.R. 43.9

DATE OF
COMPLETION

AIRCRAFT TIME
IN SERVICE

DESCRIPTION OF WORK PERFORMED
OR APPROVED DATA USED

AGENCY & CERTIFICATE NO.
WORK PERFORMED/RETURNED TO SERV



9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

DATE: 11/08/13

MODEL: 58

ACTT: 2961.1

HOBBS: 337.8

REG: N130S

S/N: TH-1588

- 1 REPLACE L/R BRAKE DISCS P/N: 164-06106 AND RE-BALANCED WHEELS.
- 2 REPLACE ALL BRAKE PADS P/N: 066-09700.


RAPHAEL LOPEZ - A&P 2709706

PERTINENT DETAILS ON FILE: W.O. 130110813

MAINTENANCE RECORD F.A.R. 43.9

SERVICE	DATE OF COMPLETION	AIRCRAFT TIME IN SERVICE	DESCRIPTION OF WORK PERFORMED OR APPROVED DATA USED	AGENCY & CERTIFICATE NO. WORK PERFORMED/RETURNED TO SERVICE
---------	--------------------	--------------------------	---	---



DATE: 07/25/13 MODEL: 58 ACTT: 2917.4 HOBBS: 294.1
REG: N130S S/N: TH-1588

ANNUAL INSPECTION COMPLETED THIS DATE. ALL APPLICABLE AD'S CHECKED AND C/W OR N/A AS LISTED IN AD LOG. I CERTIFY THAT THIS AIRFRAME WAS INSPECTED IN ACCORDANCE WITH ANNUAL INSPECTION AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION.
APPROVED FOR RETURN TO SERVICE.


STEPHEN STEWART - IA 2129169

PERTINENT DETAILS ON FILE: W.O. 130072513



DATE: 10/30/13 MODEL: 58 ACTT: 2960.9 HOBBS: 337.6
REG: N130S S/N: TH-1588

1 SWAPPED RPM INDICATOR LEFT TO RIGHT.


KENNETH TURNER - A&P 3274206

PERTINENT DETAILS ON FILE: W.O. 130103013



9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

DATE: 07/25/13 MODEL: 58 ACTT: 2917.4 HOBBS: 294.1
REG: N130S S/N: TH-1588

- 1 CW AD 2007-08-08 BY LUBRICATION OF UPLOCK ROLLERS. NEXT DUE AT HOBBS: 394.0.
- 2 CW AD 2004-25-16R1 HEATER REGULATOR LEAK CHECK. NEXT DUE JULY 2014.
- 3 CW BEECHCRAFT SERVICE BULLETIN 28-4120 BY INSPECTION OF FUEL CABLE FOR SECURITY.
- 4 INSPECTED ELT IN ACCORDANCE WITH FAR 91.207(D) (DUE AUGUST 2015)


STEPHEN STEWART - A&P 2129169

- 5 INSTALL KIT P/N: 58-5016-1A AT ENGINE CONTROL QUADRANT IAW KIT INSTRUCTIONS.


CHRISTIAN MUÑOZ - A&P 3559458

- 6 REMOVE AND RE-INSTALL VACUUM PUMP HOUSING AFTER GARLOCK SEAL WAS REPLACED BY LY-CON REBUILDING CO. UNDER WORK ORDER 42086.
- 7 INSTALL BRAKE LININGS P/N: RA066-09700 L/H MAIN.
- 8 REPLACE R/H LANDING GEAR BOOT ASSY P/N: 002-400001-129.
- 9 REPLACE LAMPS P/N: A7079B24 FROM BOTTOM BCN.
- 10 INSTALL L/R AIR FILTERS P/N: BA-7705.


DANIEL SANTILLAN - A&P 3616668

* A CORRECTION WAS MADE ON THE ACTT TO 2917.4 HOURS.


KENNETH TURNER - A&P 3274206

PERTINENT DETAILS ON FILE: W.O. 130072513

MAINTENANCE RECORD F.A.R. 43.9

DATE OF COMPLETION	AIRCRAFT TIME IN SERVICE	DESCRIPTION OF WORK PERFORMED OR APPROVED DATA USED	AGENCY & CERTIFICATE NO. WORK PERFORMED/RETURNED TO SERVICE
--------------------	--------------------------	---	---



DATE: 01/17/13 MODEL: 58 ACTT: 2917.3 HOBBS: 244.7
REG: N130S S/N: TH-1588

1 REPAIR ARM REST.


STEPHEN STEWART - A&P 2129169

2 SILICONE PATCH DOOR SEAL AT CABIN BOLT LATCH.


DANIEL SANTILLAN - A&P 3616668

PERTINENT DETAILS ON FILE: W.O. 130011713



DATE: 05/17/13 MODEL: 58 ACTT: 2922.3 HOBBS: 283.9
REG: N130S S/N: TH-1588

- 1 INSTALL THROTTLE CONTROL CABLE P/N: 102-389010-47 R/H ENGINE AND CLIP SUPPORT P/N: RA1039C.
- 2 IRAN TACH DRIVE INSPECTION, INSTALL TACH DRIVE GASKET P/N: 653023, AND GASKET P/N: 653487 BY LY-CON UNDER PO 11449.


DANIEL SANTILLAN - A&P 3616668

PERTINENT DETAILS ON FILE: W.O. 130051713

MAINTENANCE RECORD
F.A.R. 43.9

DATE OF COMPLETION	AIRCRAFT TIME IN SERVICE	DESCRIPTION OF WORK PERFORMED OR APPROVED DATA USED	AGENCY & CERTIFICATE NO. WORK PERFORMED/RETURNED TO SERVICE
--------------------	--------------------------	---	---



9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

DATE: 11/20/12 MODEL: 58 ACTT: 2904.1 HOBBS: 231.5

REG: N130S S/N: TH-1588

- 1 INSTALL L/H & R/H LED LANDING P/N: 01-0771424-20.
- 2 INSTALL TAXI LIGHT P/N: 4587.


DANIEL SANTILLAN - A&P 3616668

PERTINENT DETAILS ON FILE: W.O. 130112012

AMS AVIONICS, INC.

9504 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

DATE: 11-29-2012 MODEL: Beech 58 ACTT: HOBBS:

REG: N130S S/N: TH 1588

- 1 Removed and replaced encoding servo altimeter, installed overhauled KEA346 PN 066-3062-00 SN; 3257
KEA346 was overhauled by Global Tech Instruments FAA CRS#G3OR208N under WO# 69705

This aircraft/component above was repaired and inspected in accordance with the current FAA regulations and is approved for return to service.

PERTINENT DETAILS ON FILE: W.O 12-314


ERIC OTT
REPAIR STATION NUMBER 7AXR408B

F.A.R. 43.9

DATE OF
COMPLETION

AIRCRAFT TIME
IN SERVICE

DESCRIPTION OF WORK PERFORMED
OR APPROVED DATA USED

AGENCY & CERTIFICATE NO.
WORK PERFORMED/RETURNED TO SERVICE



9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

DATE: 10/19/12

MODEL: 58

ACTT: 2894.7

HOBBS: 222.1

REG: N130S

S/N: TH-1588

1 INSTALL R/H MAIN FLIGHT CUSTOM 3 TIRE AND INNER TUBE.

2860

CHRISTIAN MUNOZ - 3559458

PERTINENT DETAILS ON FILE: W.O. 130101912



9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

DATE: 11/07/12

MODEL: 58

ACTT: 2900.5

HOBBS: 227.9

REG: N130S

S/N: TH-1588

1 INSTALL VACUUM FILTER P/N: AA2J4-7.

2866.3

CHRISTIAN MUNOZ - A&P 3559458

PERTINENT DETAILS ON FILE: W.O. 130110712

TAKING THE BEST POSSIBLE CARE
OF YOUR AIRCRAFT BATTERIES

**MAINTENANCE RECORD
F.A.R. 43.9**

CERTIFICATE NO.
D/RETURNED TO SERVICE

169

706

68

DATE OF
COMPLETION

AIRCRAFT TIME
IN SERVICE

DESCRIPTION OF WORK PERFORMED
OR APPROVED DATA USED

AGENCY & CERTIFICATE NO.
WORK PERFORMED/RETURNED TO SERVICE



2823.7


DATE: 7/13/12
REG: N130S

MODEL: 58
S/N: TH-1588

ACTT: 2857.9

HOBBS: 185.3

ANNUAL INSPECTION COMPLETED THIS DATE. ALL APPLICABLE AD'S CHECKED AND C/W OR N/A AS LISTED IN AD LOG. I CERTIFY THAT THIS AIRFRAME WAS INSPECTED IN ACCORDANCE WITH ANNUAL INSPECTION AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION. APPROVED FOR RETURN TO SERVICE.


STEPHEN STEWART - IA 2129169

PERTINENT DETAILS ON FILE: W.O. 130071312

RECOMMENDED PRACTICE CARE
TAKING THE BEST POSSIBLE BATTERIES
OF YOUR AIRCRAFT

MAINTENANCE RECORD
F.A.R. 43.9

DATE OF
COMPLETION

AIRCRAFT TIME
IN SERVICE

DESCRIPTION OF WORK PERFORMED
OR APPROVED DATA USED

AGENCY & CERTIFICATE NO.
WORK PERFORMED/RETURNED TO SE



2023.7

DATE: 7/13/12

MODEL: 58

ACTT: 2857.9

HOBBS: 185.3

REG: N130S

S/N: TH-1588

- 1 AD 2012-10-02 IS N/A BY ACFT S/N.
- 2 AD 2012-03-06 IS N/A BY TYPE SERVO INSTALLED.
- 3 AD 2011-27-04 IS N/A BY NO STC INSTALLED.
- 4 C/W AD 2007-08-08 BY INSPECTION AND LUBRICATION OF UPLOCK ROLLERS. NEXT DUE AT HOBBS: 285.0
- 5 C/W AD 2004-25-16R1 HEATER REGULATOR LEAK CHECK. NEXT DUE JULY 2013.
- 6 C/W AD 92-23-04 BY VISUAL INSPECTION OF ENGINE CONTROL CLIPS AS PER SB 2439.
- 7 INSPECTED ELT IN ACCORDANCE WITH FAR 91.207(D) (**DUE AUGUST 2015**).


STEPHEN STEWART - A&P 2129169

- 8 C/W AD 2004-21-05 INSPECTION & HEATER DECAY TEST ON ACFT HEATER.


RAPHAEL LOPEZ - A&P 2709706

- 9 INSTALL BRAKE LININGS P/N: RA066-09700 R/H MAIN.
- 10 INSTALL SHIM BACK PLATE P/N: 06802700.
- 11 INSTALL PATCH PLATE P/N: 44B232-3 L/H ENGINE.
- 12 INSTALL L/R AIR FILTERS P/N: BA-7705.


DANIEL SANTILLAN - A&P 3616668

PERTINENT DETAILS ON FILE: W.O. 130071312

MAINTENANCE RECORD F.A.R. 43.9

SERVICE	DATE OF COMPLETION	AIRCRAFT TIME IN SERVICE	DESCRIPTION OF WORK PERFORMED OR APPROVED DATA USED	AGENCY & CERTIFICATE NO. WORK PERFORMED/RETURNED TO SERVICE
---------	--------------------	--------------------------	---	---



~~2050.8~~
2759.8

DATE: 9/15/11 MODEL: 58
REG: N130S S/N: TH-1588

ACTT: 2791.6 HOBBS: 121.4


- 1 INSTALL NEW AFT SPAR WEB KIT P/N: 58-4008-11 S/N: 658 AND NEW FORWARD SPAR WEB KIT P/N: 58-4008-9 S/N: 709. WEIGHT AND BALANCE AMMENDED.
- 2 INSTALL NEW FAIRLEAD AILERON P/N: 35-521181-1 ON RIGHT WING.


KENNETH TURNER - A&P 3274206

- 4 INSTALL NEW OXYGEN BOTTLE P/N: B6084-29 S/N: L631808.
- 5 RESEAL LANDING GEAR BOX.


RAPHAEL LOPEZ - A&P 2709706

- 5 INSTALL 2 NEW G-25 AIRCRAFT BATTERIES S/N: G02672467 AND S/N: G02531422 AND SERVICE WITH 4 QUARTS OF ACID.


CHRISTIAN CRAWFORD - A&P 3275783

PERTINENT DETAILS ON FILE: W.O. 130091511

RECOMMENDED
TAKING THE BEST POSSIBLE
OF YOUR AIRCRAFT BATTERIES

74.
206.
208
i
70

MAINTENANCE RECORD F.A.R. 43.9

DATE OF COMPLETION	AIRCRAFT TIME IN SERVICE	DESCRIPTION OF WORK PERFORMED OR APPROVED DATA USED	AGENCY & CERTIFICATE NO. WORK PERFORMED/RETURNED TO SERVICE
--------------------	--------------------------	---	---




9519 Airport Drive, Hanger 19
Visalia, CA 93277

Airframe

2717.5

DATE: 5/27/11 MODEL: 58 ACTT: 2751.7 HOBBS: 79.1
REG: N130S S/N: TH-1588

ANNUAL INSPECTION COMPLETED THIS DATE. ALL APPLICABLE AD'S CHECKED AND CW OR N/A AS LISTED IN AD LOG. I CERTIFY THAT THIS AIRFRAME WAS INSPECTED IN ACCORDANCE WITH ANNUAL INSPECTION AND WAS DETERMINED TO BE IN AIRWORTHY CONDITION.
APPROVED FOR RETURN TO SERVICE.


STEPHEN STEWART - IA 2129169

PERTINENT DETAILS ON FILE: W.O. 455385

7/1/11	99.2 HOBBS	INSTALLED NEW FLAP SWITCH P/N 8906 K367 OPS CHECKED OK <i>[Signature]</i> P/N 3290370	
8-17-11	119.3 HOBBS	INSTALLED NEW L/H MAIN TIRE P/N 301-036-00 TIRE & WHEEL ASSY STATIC BALANCED (6) NEW BRACKS P/N 66-44 installed on L/H main wheel BRACKS TIRE TESTED TO SEASON BRACKS <i>[Signature]</i> P/N 3290370	

MAINTENANCE RECORD F.A.R. 43.9

DATE OF COMPLETION	AIRCRAFT TIME IN SERVICE	DESCRIPTION OF WORK PERFORMED OR APPROVED DATA USED	AGENCY & CERTIFICATE NO. WORK PERFORMED/RETURNED TO SERVICE
--------------------	--------------------------	---	---



2717.5

DATE: 5/27/11 **MODEL:** 58 **ACTT:** 2751.7 **HOBBS:** 79.1
REG: N130S **S/N:** TH-1588

- 1 C/W 100 HOUR INSPECTION IAW BEECHCRAFT MAINTENANCE FORM P/N: 118662Q.
- 2 C/W BEECH SI0166-258 R1 BY INSPECTION OF FLEX DUCTS. NO DISCREPANCIES NOTED AT THIS TIME.
- 3 C/W BEECH SI0553-254 BY INSPECTION OF BOTH PROP GOVERNORS CONTROL ARMS FOR PROP SAFETY. NO DISCREPANCIES NOTED AT THIS TIME.
- 4 C/W BEECH SI 0632-280 R1 BY INSPECTION FOR FUEL SEEPAGE. NO DISCREPANCIES NOTED AT THIS TIME.
- 5 INSTALL 2 NEW AIR INDUCTION FILTERS P/N: BA-7705.
- 6 INSTALL NEW NOSE WHEEL BEARING SEAL P/N: 154-03200.
- 7 REPLACED BRAKE INSULATOR SHIM.
- 8 INSTALL OVERHAULED LANDING GEAR ACTUATOR MOTOR P/N: 58-380090-1 S/N: 11856.
- 9 INSTALL NEW ALTERNATOR CONTROL RELAY P/N: SM200010.
- 10 INSTALL OVERHAULED # 5 CYLINDER P/N: 654651 S/N: 37725-1.
- 11 INSPECTED ELT IN ACCORDANCE WITH FAR 91.207(D) (DUE APRIL 2015).

DARRELL E. TUNNELL - A&P 3275726

PERTINENT DETAILS ON FILE: W.O. 455385